



## INTRODUCTION

Amazon's crusade to make household objects more smart (and make more smart household objects) continues this month with the Tap, their first Alexa-equipped portable speaker. Featuring streaming audio and a built-in personal assistant, Tap promises to make your life easier and more connected. But you know what we say—it's what's inside that counts! Join us and find out *exactly* how smart this speaker is.

Want a look at Tap's landlocked cousins? Head on over to our teardowns of the all-new [Echo Dot](#) and the original [Amazon Echo](#) to see how this model stacks up.

Not ready to tap out? Follow us on [Instagram](#), [Twitter](#), and [Facebook](#) for more teardown and repair news.

---

### TOOLS:

- [T6 Torx Screwdriver](#) (1)
  - [T9 Torx Screwdriver](#) (1)
  - [Metal Spudger](#) (1)
  - [Tweezers](#) (1)
  - [iFixit Opening Picks set of 6](#) (1)
-

## Step 1 — Amazon Tap Teardown



- This is Amazon's first portable, Alexa-powered device, so we're excited to see how they've switched things up. Features include:
  - Button-activated Alexa Voice Service
  - Up to 9 hours of audio playback on a single charge
  - Dual 1.5-inch drivers and dual passive radiators for bass extension
  - Single-band 802.11b/g/n Wi-Fi and Bluetooth 4.2
  - Charging cradle
- While we're sharpening our tools, here's a sneak peek via [X-ray](#).

## Step 2



- *Faceoff!* On the right we have the Tap, and on the left, its wirebound siblings. Go on, guys, introduce yourselves.
- Tap's charging cradle sports two spring contacts that connect to the base at any angle, thanks to this target-shaped pair of circular contacts on the bottom of the Tap.
- Taking a closer look, we see Tap's model number, PW3840KL, alongside all the usual suspects.


## Step 3



- With a couple other cylindrical Amazon teardowns under our belt, we know the drill. The first piece out of this puzzle is the base's rubber footing.
- Seconds later, a few T9 Torx screws bite the dust, and we get our first look inside.

**⚠ It's just a peek, though—our path forward is blocked by the molded plastic housing. Time to check for other possible points of entry.**

## Step 4

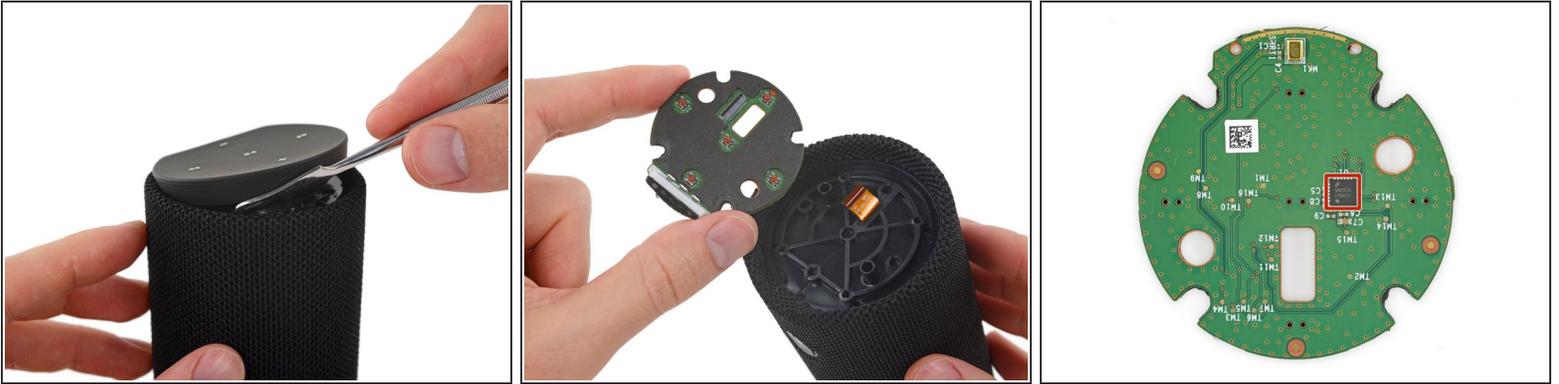

- Undeterred, we turn our ~~attention~~ spudger to the rubberized control panel at the other end.
- With some assertive prying, the plastic clips give way to reveal a control button breakout board featuring some buttons, a microphone, and a lone IC:
  - National Semiconductor [LP55231](#) Programmable 9-Output LED Driver (as seen in the [Echo](#) and [Echo Dot](#))
- Unfortunately, there are no fasteners lurking at this end either. Time to get ~~creative~~ destructive!

## Step 5



- Thwarted by a lack of screws at either end, it seems that there's no easy way to Alexa's heart. So, let's do things the hard way.
- First off of the Tap's cowling is the stretchy fabric wrap, which we unroll from the cowling's firmly adhered outer surface.
  - Aaaaand still no screws.


**⚠** What we have here is a sticky situation. Many a brave pry tool met its doom attempting to bypass the Tap's flypaper exterior.

## Step 6




- After a good amount of finagling, we finally manage to wriggle the cowling free by sliding it over the power, Bluetooth, and microphone buttons.
- It may not look like progress, but it is. Just a few screws stand between us and those Taptastic interior goodies.
- Suddenly the microphone button comes out all willing-like. That would have been helpful in the *prior* step, but we'll take it!

## Step 7

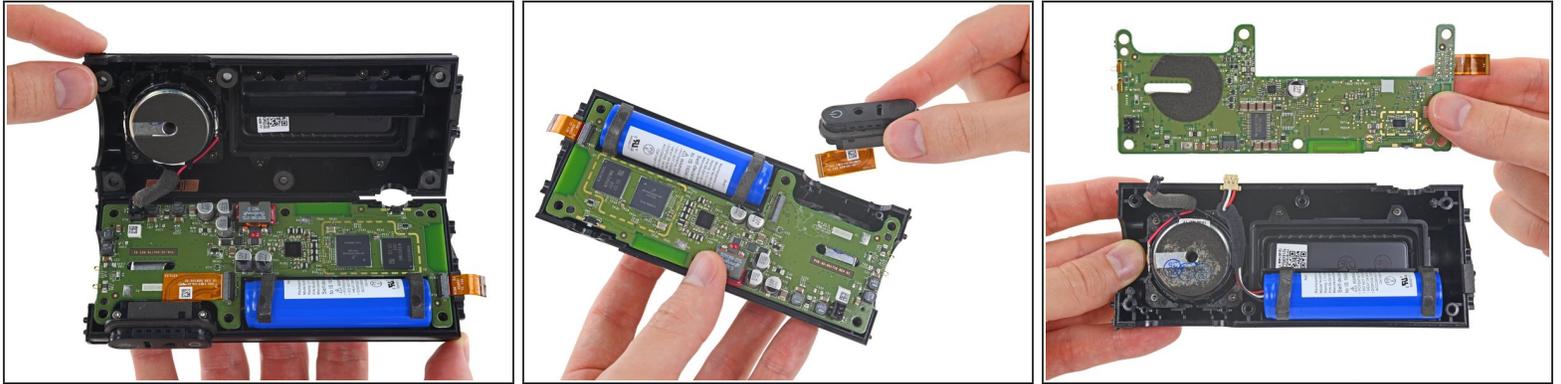


- With the sheath shucked and a handful of screws dispatched, the Tap falls open like a book.
- And things are looking up! The I/O panel, mounted by way of a couple screws, attaches to the motherboard via a flex cable *and* slides right out.
- ⓘ That means replacing the USB port, a commonly failing component in mobile devices, will be possible if not totally painless.
- Moving right along, the motherboard jumps out to join the party.

## Step 8

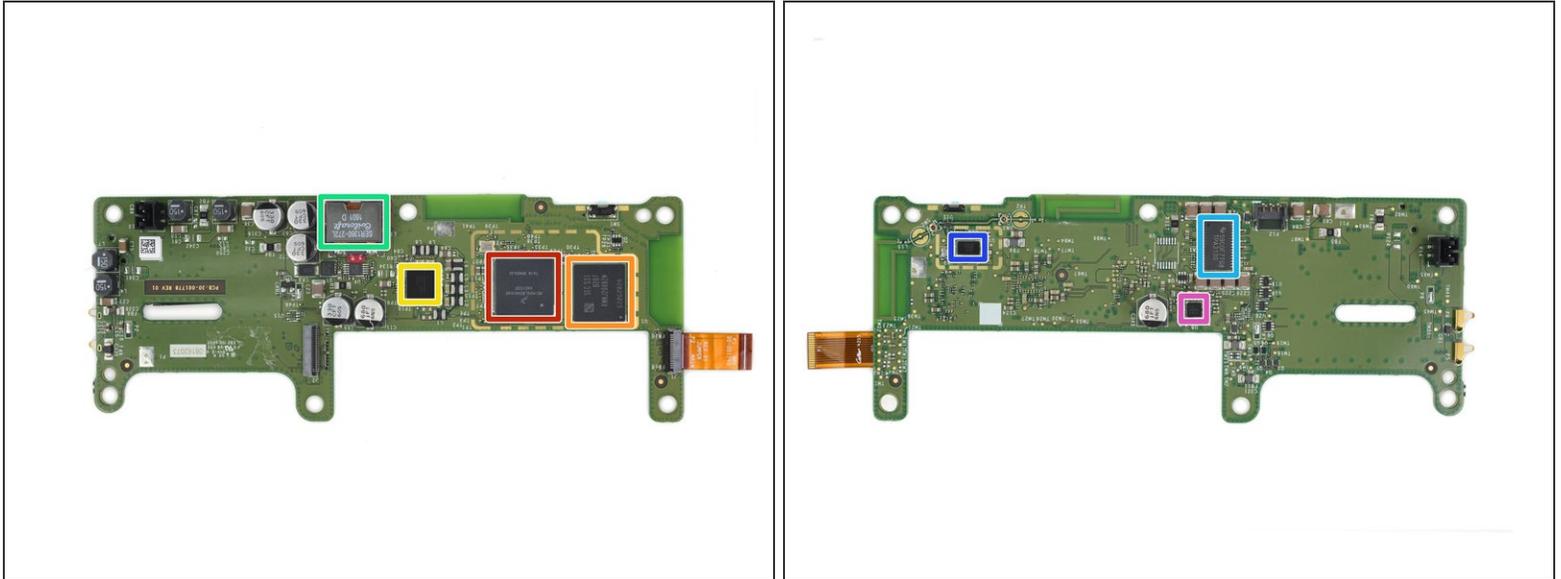


- Reaching the brains of this smart speaker, we do our due diligence and identify all the key players:
  - Freescale/NXP [MCIMX6L8DVN10AB](#) i.MX 6SoloLite Applications Processor
  - Samsung KMNJ2000ZM-B207 512 Mb DDR2 SDRAM Memory (likely)
  - Maxim MAX77697 PMIC
  - Coilcraft [SER1360-272L](#) High Current Shielded Power Inductor
  - Texas Instrument [TPA3130](#) 15W Filter-Free Class D Stereo Amplifier
  - Broadcom [BCM4343](#) Wi-Fi and Bluetooth 4.2/Bluetooth Smart SoC
  - Maxim [MAX98090](#) Ultra-Low Power Stereo Audio Codec

## Step 9

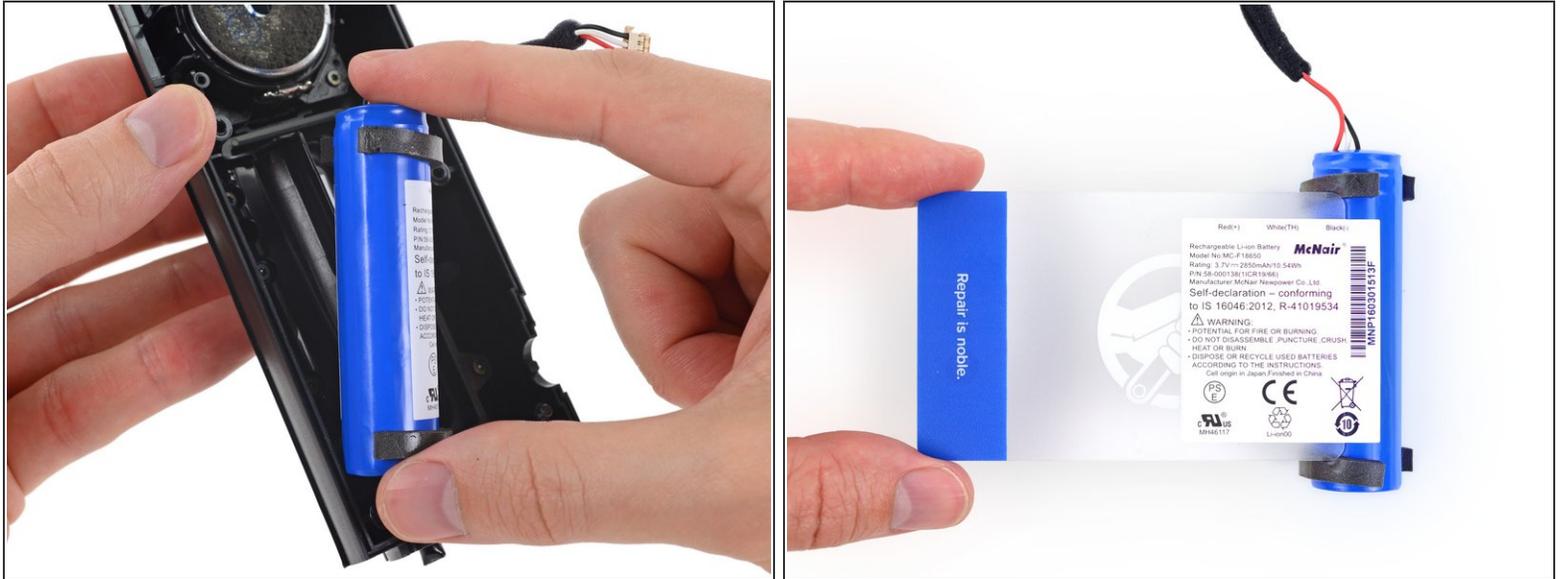

- Next to come out is a standard 18650 Lithium Ion cell, widely used in the industry from [Tesla](#) vehicles to [self-balancing boards](#).
- ⓘ This unit is rated for 2850 mAh at 3.7 V to yield 10.54 Wh, which Amazon says will provide up to 9 hours of music playback.
- Compare that with the 3.8 V, 2750 mAh, 10.45 Wh battery in the [iPhone 6s Plus](#)—a battery with a similar output for a radically different job.

## Step 10

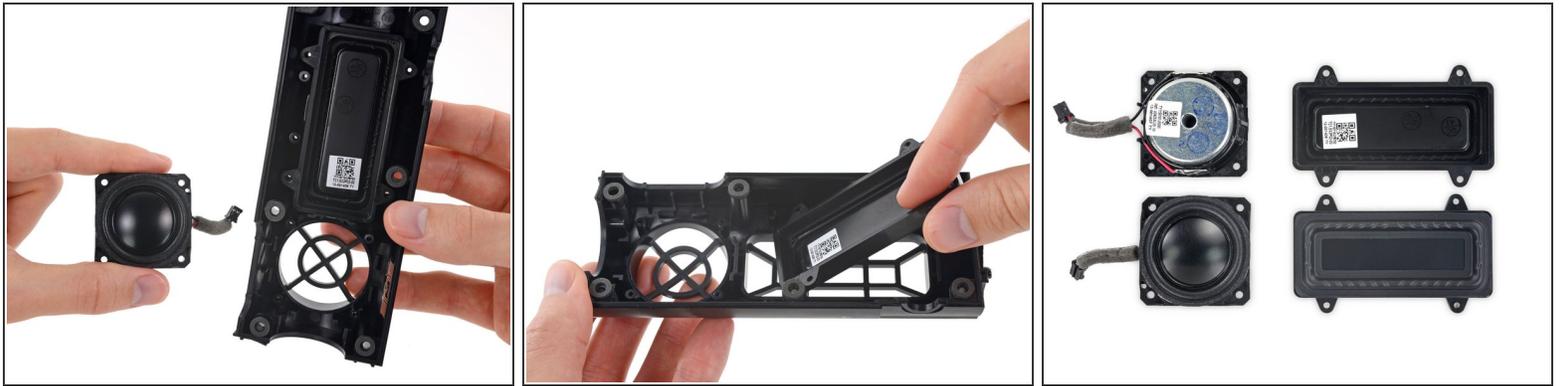

- We're down to the real heavy hitters: the speakers!
- These little 1.5-inch drivers each pair with a larger [passive radiator](#) to improve lower end frequency response without additional large drivers or a base response tube.

## Step 11



- Okay but seriously, those passive radiators aren't even connected to anything. How important could they be?
- We thought you'd never ask. What we have here is a reassembled Tap with a conspicuous absence of passive radiators. So how does it sound?
- In a word, *bad*. Just for kicks, we ran a [audio spectrum test](#) with the passives out, and again with them in. Our puny human test subjects couldn't even hear the signal below 120 Hz—until we reinstalled the passive radiators, at which point they confidently identified a bassy rumble all the way down at ~90 Hz.
- Good job, passive radiators.

## Step 12



## REPAIRABILITY SCORE:



- Amazon Tap Repairability Score: **7 out of 10** (10 being the easiest to repair)
  - The battery, control board, I/O board, and speakers all connect to the motherboard via standard cable connectors.
  - Most components are held in with easily-undone clips or standard screws.
  - Removing the cowling requires a significant amount of force, but it is a nondestructive process.
  - Repairs are straightforward *if* you know your way in, but could be daunting without a service manual.
  - Tough adhesive holds the rubber footing to the base.